

GENERAL APTITUDE

Q. No. 1 – 5 Carry One Mark Each

1.	The perimeters of a circle, a square and an equilateral triangle are equal. Which one of the following statements is true?	
	(A) The circle has the largest area	
	(B) The square has the largest area	
	(C) The equilateral triangle has the largest area	
	(D) All the three shapes have the same area.	
An	ver: (A)	
		•
2.	Find the missing group of letters in the following series:	
	BC, FGH, LMNO,	
	(A) UVWXY (B) TUVWX (C) STUVW (D) RSTUV	
An	ver: (B)	
3.	"The judge's standing in the legal community, though shaken by false allegations of wrongdoing, remained"	
	The world that best fills the blank in the above sentence is	
	(A) Undiminished (B) damaged	
	(C) illegal (D) uncertain	
An	ver: (A)	
	(d) (A)	
4.	The value of the expression $\frac{1}{1 + \log_{u} vw} + \frac{1}{1 + \log_{v} wu} + \frac{1}{1 + \log_{w} uv}$ is	
	(A) -1 $(B) 0$ $(C) 1$ $(D) 3$	
An	ver: (C)	



5.	"The dress her so well that they all immediately her on her appearance."
٠.	The words that best fill the blanks in the above sentence are
	(A) complemented, complemented (B) complimented, complemented
	(C) complimented, complimented (D) complemented, complimented
A 1	
	nswer: (D)
	Q. No. 6 – 10 Carry Two Marks Each
6.	Forty students watched films A, B and C over a week. Each student watched either only one film or all three. Thirteen students watched film A, sixteen students watched film B and nineteen students watched film C. How many students watched all three films?
	(A) 0 (B) 2 (C) 4 (D) 8
Aı	nswer: (A)
7.	A house has a number which needs to be identified. The following three statements are given that can help in identifying the house number.
	(i) If the house number is a multiple of 3, then it is a number from 50 to 59.
	(ii) If the house number is NOT a multiple of 4, then it is a number from 60 to 69.
	(iii) If the house number is NOT a multiple of 6, then it is a number from 70 to 79.
	What is the house number?
	(A) 54 (B) 65 (C) 66 (D) 76
Aı	nswer: (D)
8.	A contract is to be completed in 52 days and 125 identical robots were employed, each operational for 7 hours a day. After 39 days, five-seventh of the work was completed. How many additional robots would be required to complete the work on time, if each robot is now operational for 8 hours a day?
	(A) 50 (B) 89 (C) 146 (D) 175
Aı	nswer: (0)
9.	An unbiased coin is tossed six times in a row and four different such trials are conducted. One trial implies six tosses of the coin. If H stands for head and T stands for tail, the following are the observations from the four trials:
	(1) HTHTHT (2) TTHHHT (3) HTTHHT (4) HHHT



Which statement describing the last two coin tosses of the fourth trial has the highest probability of being correct?

(A) Two T will occur

(B) One H and one T will occur

(C) Two H will occur

(D) One H will be followed by one T

Answer:

(B)

- 10. A wire would enclose an area of 1936 m², if it is bent into a square. The wire is cut into two pieces. The longer piece is thrice as long as the shorter piece. The long and the short pieces are bent into a square and a circle, respectively. Which of the following choices is closest to the sum of the areas enclosed by the two pieces in square meters?
 - (A) 1096
- (B) 1111
- (C) 1243 (D) 2486

Answer: **(C)**

PRODUCTION ENGINEERING

Q.No.1-25 Carry One Mark Each

Vector triple product $\mathbf{a} \times (\mathbf{b} \times \mathbf{c})$ of three vectors \mathbf{a} , \mathbf{b} and \mathbf{c} is given by 1.

(A)
$$(a \cdot c)b - (a \cdot b)c$$

(B)
$$(b \cdot c)a - (a \cdot c)b$$

(C)
$$(a \cdot b)c - (a \cdot c)b$$

(D)
$$(b \cdot c)a - (a \cdot b)c$$


Answer: (A)

- A real-valued function y of real variable x is such that y = 5|x|. At x = 0, the function is 2.
 - (A) discontinuous but differentiable
 - (B) both continuous and differentiable
 - (C) discontinuous and not differentiable
 - (D) continuous but not differentiable

(D)



3. Considering the coordinate system shown in the figure, a force of magnitude 10 kN has x-component of -6 kN. Possible y-component (s) of the force is/are

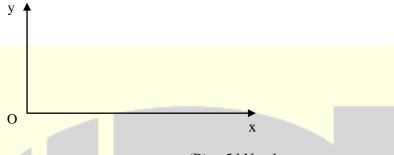

(A) +8 kN only

(B) +5 kN only

(C) +8 kN and -8 kN

(D) +5 kN and -5 kN

Answer: (C)

4. When austenite decomposes upon cooling into two phases—ferrite and cementite, the reaction is called

(A) Eutectic

- (B) Eutectoid
- (C) Peritectic
- (D) Peritectoid

Answer: (B)

5. Match the geometric tolerances with their correct symbols:

P. Flatness	1.	
Q. Perpendicularity	2.	
R. Concentricity	3.	
S. Roundness (Circularity)	4.	



	(A)	P-1, Q-3, R-4	S - 2	(B) $P-3, Q-1,$	R - 4, S - 2
	(C)	P-3, Q-1, R-2	2, S-4	(D) $P-3, Q-2,$	R - 1, S - 4
Answ	er:	(B)			
6.	Wh	ich one of the follow	ving instruments make	s use of the principle of	f interference of light?
	(A)	Optical flat		(B) Auto-collima	ator
	(C)	Optical projector		(D) Coordinate m	neasuring machine
Answ	er:	(A)			
7.	In A	ASME process chart	, the symbol \Box represe	ents	
	(A)	operation	(B) inspection	(C) delay	(D) transport
Answ	er:	(B)			
8.		ich one of the foll vidual readings with	-	opropriate control cha	rt for measuring the variability of
	(A)	\overline{X} – chart	(B) R-chart	(C) p-chart	(D) c-chart
Answ	er:	(B)			
9.		machines and auxoduced in very large	•	ocated according to p	rocessing sequence of the produc
	(A)	Process Layout		(B) Fixed Positio	n Layout
	(C)	Product Layout		(D) Cellular Layo	out
Answ	er:	(C)			
10.	Wh	ich one of the follow	ving defects is NOT as	sociated with the castir	ng process?
	(A)	Hot tear	(B) Porosity	(C) Blister	(D Central burst
Answ	er:	(D)			
11.		nn oxy-acetylene gume). The flame is	as welding process, o	oxygen and acetylene	are mixed in a ratio of 1.5:1 (by
	(A)	neutral	(B) carburizing	(C) reducing	(D) oxidizing
Answ	er:	(D)			



12.				nufactures 100 lakhs components. The number of defecte 30, 42 and 47, respectively. The firm(s) in conformance			
	(A)	only P	(B) P and Q	(C) P,	Q and R	(D) Q and I	₹
Answe	er:	(A)					
13.		make holes of 0.5 cess is	mm diameter and 30) mm depth	in a mild ste	eel component,	the most suitable
	(A)	chemical machinin	g	(B) ele	ectrochemical	l machining	
	(C)	abrasive jet machin	ing	(D) pla	asma arc mac	hining	
Answe	er:	(B)					
14.	Wh	ich one of the follow	ring processes is NOT	used for pro	ducing power	ders?	
	(A)	Atomization		(B) Ba	ll milling		
	(C)	Sintering		(D) Ele	ectrolysis		
Answe	er:	(C)					
15.	The	process in which m	olten thermoplastic is	forced between	een rolls to p	roduce thin she	ets is called
	(A)	blow moulding		(B) co	mpression m	oulding	
	(C)	calendering		(D) ext	trusion		
Answe	er:	(C)					
16.		e diagonal elements each, the third eiger	of a 3-by-3 matrix a	re -10, 5 and	l 0, respectiv	vely. If two of	its eigenvalues are
Answe	er:	(24.5to 25.5)					
17.		ights (in kg) of six ce) is	products are 3, 7, 6,	2, 3 and 4.	The median	weight (in kg,	up to one decimal
Answe	er:	(3.49 to 0.51)					



18.		multa			re $P(F) = 0.3$ and $P(G) = 0.4$, respectively. The $(F \cap G) = 0.2$. The probability of occurrence of at					
Ans	Answer: (0.48 to 0.51)									
19.		A flywheel in the form of a solid circular disc of radius 100 mm and uniform thickness has a mass of 10 kg. If it is rotating at a uniform angular velocity of 20 rad/s, the kinetic energy (in J) of the flywheel is								
Ans	swer: (9.9 to 10.1)									
20.	,	gth 50 2 800 l	cm i kg/m³	s floatii and 10	ng in water in such a way that its axis is vertical. 00 kg/m³, respectively. The submerged depth, i.e.,					
Ans	swer: (39 to 41)									
21.	are 0.97, 0.86 and 0.93, respectively	y. To	increa	ise the i	connected serially. The reliabilities of P, Q and R reliability of the machine, two additional stand-by ro decimal places) of the machine is					
Ans	swer: (0.88 to 0.91)									
22.	mean time to repair (in hour) is				our. If the availability of the machine is 80%, the					
23.	Processing times on a single machin	e for	3 jobs	are giv	en below. All the jobs are available at time $t = 0$.					
	Job	1	2	3						
	Processing time (minute)	15	3	6						
Ans	swer: (11.8 to 12.2)			•	cessing time (SPT) sequence is					
24.	In a two-pass wire drawing process, further 30% reduction in 2 nd pass. The				duction in wire cross-sectional area in 1st pass and in (in percentage) is					
Ans	swer: (57 to 59)									
	© All rights reserved by Thinkcell Learning Solutions Pvt. L	.td. No pa	art of this	booklet may	be reproduced or utilized in any form without the written permission.					



25. A double-start thread with a pitch of 2 mm is to be cut using a lathe machine. The pitch of the leadscrew of the lathe is 6 mm. The job rotates at 60 revolution per minute (RPM). The RPM of the leadscrew is

Answer: (39 to 41)

Q.No.26-55 Carry Two Marks Each

- Consider the analytic function $f(z) = x^2 y^2 + i2xy$ of the complex variable z = x + iy, where $i = \sqrt{-1}$. 26. The derivative f'(z) is
 - (A) 2x + i2y

- (B) $x^2 + iy^2$ (C) x + iy (D) 2x i2y

Answer: (A)

In order to evaluate the integral $\int e^x dx$ with Simpson's $1/3^{rd}$ rule, values of the function e^x are used at **27.**

x = 0.0, 0.5 and 1.0. The absolute value of the error of numerical integration is

- (A) 0.000171
- (B) 0.000440
- (C) 0.000579
- (D) 0.002718

Answer: (C)

- 28. A rigid link PQ of length 1.0 m is pinned at P. It rotates about P in a vertical plane with a uniform angular acceleration of 1.0 rad/s². At an instant when the angular velocity of the link is 1.0 rad/s, the magnitude of total acceleration (in m/s²) of point Q relative to point P is
 - (A) 1.41
- (B) 1.73
- (C) 2
- (D) 2.83

Answer: (A)

29. In a shaft-hole system, the dimensions with tolerances (in mm) are as follows:

Shaft: $\phi 20^{+x}_{-x}$ Hole: $\phi 20^{-0.03}_{-v}$

where both x and y are positive real numbers. Which one of the following will provide an interference

(A) x = 0.05, y = 0.040

(B) x = 0.04, y = 0.035

(C) x = 0.04, y = 0.032

(D) x = 0.02, y = 0.035

Answer: (D)



30. A machine is procured at a price of Rs. 47000 with a 2-year warranty. After two years, the annual maintenance cost (AMC) in Rs. is given by the following formula:

AMC =
$$(i-2) \times 2000$$
, for $i > 2$

where i is the number of years elapsed since the machine was purchased. Neglect the scrap value of the machine, inflation, interest, etc. For minimizing the average cost, the machine should be replaced at the end of the year

- (A) 2
- (B) 4

- (C) 7
- (D) 10

Answer: (C)

In a service centre, cars arrive according to Poisson distribution with a mean of 2 cars per hour. The time 31. for servicing a car is exponential with a mean of 15 minutes. The expected waiting time (in minute) in the queue is

- (A) 10
- (B) 15
- (C) 25
- (D) 30

Answer: (B)

32. Actual and forecasted demands of a product are as follows:

Period	1	2	3	4	5
Actual demand	180	170	165	170	200
Forecasted demand	190	190	190	190	190

The forecast error measured in terms of mean absolute deviation (MAD) and mean absolute percentage error (MAPE), respectively, are

(A) 13 and 7.84%

(B) 13 and 9.85%

(C) 17 and 7.84%

(D) 17 and 9.85%

Answer:

- **33.** In a mass production firm, measurements are carried out on 10000 pairs of shaft and hole. The mean diameters of the shaft and hole are 37.53mm and 37.59mm, respectively. The corresponding standard deviations are 0.03mm and 0.04mm. The mean clearance and its standard deviation (both in mm), respectively, are
 - (A) 0.06 and 0.07
- (B) 0.06 and 0.06
- (C) 0.06 and 0.05 (D) 0.07 and 0.01

Answer: (C)



34.	Mould-filling tir metal (density 2	asting set-up was tested by a me was found to be 0.05 s. 2000 kg/m ³) at an injection approximate mould-filling	Afterwards, the actual pressure of 400 ba	al casting is made by injection	ecting the liquid
	(A) 0.05	(B) 0.075	(C) 0.1	(D) 0.2	
Answ	er: (A)				
35.	The value of	the surface integral $\iint_{S} (s)$	9xi - 2yj - zk) • ndS	over the surface S	of the sphere
		3			
	$x^2 + y^2 + z^2 = 9,$	where n is the unit outward	d normal to the surface	ce element dS, is	·
Answ	er: (675 to 681)			
36.	Consider the diff	ferential equation $2\frac{d^2y}{dt^2} + 8y$	y = 0		
	with initial cond	itions:			
	At $t = 0$, $y = 0$ an	$\frac{dy}{dt} = 10$			
	The value of y (up to two decimal places) at	t = 1 is		
Answ	er: (4.52 to 4.5	6)			
37.	One kg of air (th	nat can be considered a cal-	orically perfect gas v	vith characteristic gas co	onstant $R = 287$
	J/kg-K and spe	cific heat ratio $\gamma = 1.4$) un	ndergoes a constant-	-volume process from	an initial static
	pressure of 1 bar	to a final static pressure of	4 bar. The increase in	n entropy (in J/kg-K) of	air is
Answ	er: (990 to 100	0)			
38.	If $u = 2(x^2 - y^2)$	and $v = -axy$ represent th	e x-and y-component	ts of the two-dimension	al velocity field
	of an incompress	sible flow, the value of the c	constant a is		
Answ	er: (3.9 to 4.1)				
39.	• •	sure vessel (made of mild internal gauge pressure of			

factor of safety (up to one decimal place) is _____

Answer: (3.6 to 4.4)




40. A square cross-section wooden column of length 3140 mm is pinned at both ends. For the wood, Young's modulus of elasticity is 12 GPa and allowable compressive stress is 12 MPa. The column needs to support an axial compressive load of 200 kN. Using a factor of safety of 2.0 in the computation of Euler's buckling load, the minimum cross-sectional area (in mm²) of the column is ______

Answer: (19800 to 20200)

41. Length, width and thickness of a plate are 400 mm, 400 mm and 30 mm, respectively. For the material of the plate, Young's modulus of elasticity is 70 GPa, yield stress is 80 MPa and Poisson's ratio is 0.33. When the plate is subjected to a longitudinal tensile stress of 70 MPa, the increase in the volume (in mm³) of the plate is _____

Answer: (1575 to 1650)

42. In a V-thread, a wire is fitted such that it makes contact with the flank of the thread on the pitch line as shown in the figure. If the pitch p of the thread is 3 mm and the included angle is 60°, the diameter (in mm, up to one decimal place) of the wire is _____

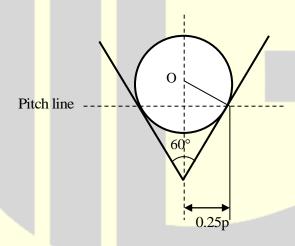

Answer: (1.6 to 1.8)



43. A project consists of three activities P, Q and R. The durations of activities follow Beta distribution. The predecessors and durations of activities are as per the following table:

Activity	Predecessors	Optimistic time (month)	Most likely time (month)	Pessimistic time (month)
P	_	2	3	10
Q	P	3	5	13
R	Q	3	4	5

The expected project completion time (in month) is _____

Answer: (13.9 to 14.1)

44. A company has two manufacturing plants (C_1 and C_2) and two distribution centres (D_1 and D_2). The capacities of C_1 and C_2 are 100 and 200 units, respectively. The demand for D_1 and D_2 are 190 and 110 units, respectively. The costs per unit (in Rs.) of transportation at different routes are as per the following matrix:

	D_1	D_2
C ₁	22	21
C ₂	20	27

The minimum total cost (in Rs.) of transportation is _____

Answer: (6165 to 6175)

45. The annual demand of an item is 19845 units and the production rate is 100 units per day. The per-unit production cost (excluding setup cost) is Rs. 50, the per-unit holding cost is Rs. 10 per year and setup cost is Rs. 520 per setup. To minimize the total annual cost, the optimum quantity to be produced per setup is _____

Answer: (2100 to 2155)



46. A production line operates 7 hours a day in a 5-day week. The processing times for various job elements are as follows:

Job element	p	q	r	s	t
Processing time (s)	5	10	12	3	15

If the line is designed for an output of 8400 units per week, the theoretical minimum number of work stations required is _____

Answer: (2.8 to 3.2)

47. In a work sampling study of a worker, the information available are as follows: total time of study: 30 hour, number of items produced: 320, total number of observations: 1000, number of observations when worker is found working: 850 and average performance rating: 105%. Company policy is to give allowance of 10% of total time on the job. The standard time (in minute per item, up to one decimal place) for manufacturing the item is _____

Answer: (5.2 to 5.8)

48. The breakeven point of a manufacturing company is 50000 units. The fixed cost is Rs. 200000 and the variable cost per unit is Rs. 20. The selling price per unit (in Rs.) of the product at this breakeven point is


Answer: (23.8 to 24.2)

49. A 10 mm thick plate is rolled to 7 mm thickness in a rolling mill using 1000 mm diameter rigid rolls. The neutral point is located at an angle of 0.3 times the bite angle from the exit. The thickness (in mm, up to two decimal places) of the plate at the neutral point is ______

Answer: (7.1 to 7.4)



50. A cylindrical workpiece is turned at a feed of 0.1 mm/rev with a perfectly sharp tool. In ASA system, the side and end cutting edge angles are 15° and 5°, respectively, as shown in the figure. The peak-to-valley roughness (in μm, up to one decimal place) of the machined surface is ______

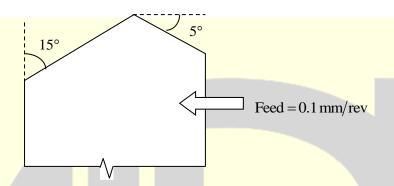

Answer: (8.4 to 8.7)

51. The worktable in a CNC machine is driven by a leadscrew with a pitch of 2 mm. The leadscrew is directly coupled to a stepper motor of step angle 1.8°. The number of pulses required to move the worktable by 50 mm is _____

Answer: (4999 to 5001)

52. During orthogonal machining of a job at a cutting speed of 90 m/min with a tool of 10° rake angle, the cutting force and thrust force are 750 N and 390 N, respectively. Assume a shear angle of 35°. The power (in W) expended for shearing along the shear plane is ______

Answer: (630 to 641)

53. In an electrochemical machining of aluminium with plane parallel electrodes, the current density is 70 A/cm². Cross-sectional area of each electrode is 3 cm². The current efficiency (i.e., the fraction of current used for dissolution of metal) is 80%. Gram atomic weight, valency and density of aluminium are 27 gram, 3 and 2700 kg/m³, respectively. Take Faraday's constant as 96500 Coulomb. The volumetric material removal rate (in mm³/min) is ______


Answer: (345 to 551)



54. Two metallic sheets are spot welded by passing a current of 8000 A for 0.2 s. Assume that a cylindrical nugget of 8 mm diameter and 3 mm depth is formed. The density of the nugget is 7500 kg/m³, effective resistance of the total system is 222 micro-Ohm and heat required to produce 1.0 gram of nugget is 1400 J. The percentage of heat actually utilized in producing the nugget is _____

Answer: (53 to 58)

In a planar 2-degree-of-freedom robot, Link 1 of 30 cm length is connected to base by a revolute joint 55. and Link 2 of length 20 cm is connected to Link 1 with a revolute joint as shown in the figure. The work-envelope area (in cm²), covered by point P, is _____

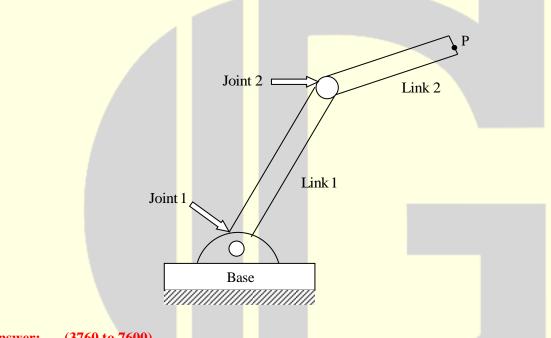

(3760 to 7600) **Answer:**

